


# **Inspection Report**

## **Danica Sample**

## **Property Address:**

33977 Stara Lane Hendersonville NC



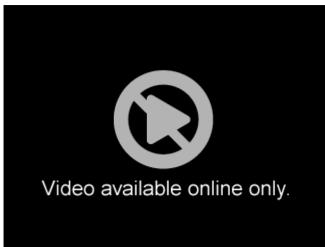

## **3DC Inspection**

Cleveland Bailey 450.011994 2131 S. 17th Ave (Suite 646 Broadview, Illinois 60155 (708) 735-4018 3DC INSPECTION Sample

## **Table of Contents**

Cover Page	<u> 1</u>
Table of Contents	2
Intro Page	3
1 Roofing / Chimneys / Roof Structure and Attic	4
2 Exterior	<u>6</u>
3 Garage	12
4 Kitchen Components and Appliances	13
5 Rooms	16
6 Bathroom and Components	20
7 Structural Components	21
8 Plumbing System	22
9 Electrical System	23
10 Heating / Central Air Conditioning	24
11 Home Warranty Offer	27
General Summary	28
Invoice	39

**33977 Stara Lane** Page 2 of 39

<b>Date:</b> 3/30/2012	Time:	Report ID: 33977staralane
<b>Property:</b> 33977 Stara Lane Hendersonville NC	<b>Customer:</b> Danica Sample	<b>Real Estate Professional:</b> Victor Tate Victor Realty

### **Comment Key or Definitions**

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

**Inspected (IN)** = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

**Not Inspected (NI)**= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

**Not Present (NP)** = This item, component or unit is not in this home or building.

**Repair or Replace (RR)** = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

In Attendance: Type of building: Approximate age of building: Customer Single Family (1 story) Under 5 Years Temperature: Weather: **Ground/Soil surface condition:** Over 65 Cloudy Drv **Water Test:** Rain in last 3 days: Radon Test: Yes Yes, No No

**33977 Stara Lane** Page 3 of 39

## 1. Roofing / Chimneys / Roof Structure and Attic

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of' leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

1.0	Roof Coverings			•
1.1	Flashings	•		
1.2	Skylights, Chimneys and Roof Penetrations	•		
1.3	Roof Ventilation	•		
1.4	Roof Drainage Systems (gutters and downspouts)			•
1.5	Roof Structure and Attic (Report leak signs or condensation)	•		
1.6	Ventilation Fans and Thermostatic Controls (Attic)	•		
1.7	Insulation in Attic	•		
1.8	Visible Electric Wiring in Attic	•		

 ${\sf IN=Inspected,\,NI=Not\,Inspected,\,NP=Not\,Present,\,RR=Repair}$  or Replace

IN NI NP RR

## IN NI NP RR Styles & Materials

Viewed roof covering from:

Ground

Roof-Type:

Gable

Roof Covering: 3-Tab fiberglass

Chimney (exterior):
Rock

Sky Light(s):

Three

Roof Ventilation: Ridge vents

Method used to

observe attic:

Soffit Vents

Walked

**Roof Structure:** 

Engineered wood trusses 2 X 12 Rafters Lateral bracing Sheathing

**Ceiling Structure:** 

2X6

Attic info:

Pull Down stairs

**Attic Insulation:** 

Blown Cellulose R-30 or better

### **Comments:**

**33977 Stara Lane** Page 4 of 39

**1.0** (1) Evidence of a leak in the Den below corresponds with the middle skylight roof and flashing area. Repairs are needed. Recommend a qualified contractor inspect further and repair as needed.


(2) The roof covering was installed improperly above garage. Roof sheathing needs to be replaced in this area. This will involve some shingle replacement. A qualified contractor should inspect and repair as needed.




1.0 Item 1(Picture)

- ▲ 1.4 The gutter screens are missing at the front of home above garage. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.
- **1.5** No longer an attic access. Use the pull down stairs at garage.





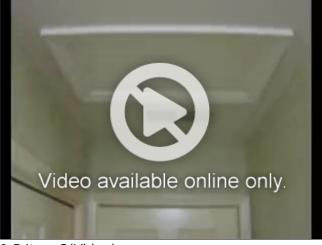

1.5 Item 2(Video)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 5 of 39

### 2. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.



### IN NI NP RR Styles & Materials

2.0	Wall Cladding, Flashing and Trim		•
2.1	Doors (Exterior)	•	
2.2	Windows	•	
2.3	Decks, Balconies, Balconies, Stoops, Steps, Areaways, Porches, Patio/ Cover and Applicable Railings	•	
2.4	Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)		•
2.5	Eaves, Soffits and Fascias		•
2.6	Plumbing Water Faucets (hose bibs)	•	
2.7	Outlets (Exterior)	•	
2.8	Other	•	

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

### Siding Style:

RB&B (Reverse board and batten)
Brick

### Siding Material:

Wood Full brick

### **Exterior Entry Doors:**

Steel Insulated glass

#### **Appurtenance:**

Covered porch Porch Sidewalk Patio

#### **Driveway:**


Asphalt

**Comments:** 

**33977 Stara Lane** Page 6 of 39

**<a>^ 2.0** The Wood siding at the right side (facing front) and rear of home is missing or incomplete at time of inspection around new premium windows that have recently been installed. I did not inspect the installation of siding at this location. A qualified contractor should inspect and repair as needed. The siding will need prep and paint.



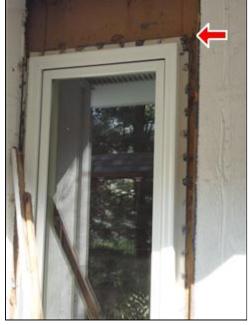

2.0 Item 1(Picture)

2.0 Item 2(Picture)







2.0 Item 4(Picture)

**33977 Stara Lane** Page 7 of 39

**2.4** (1) Possible water run-off from the street into driveway during rain. I am unable to determine the frequency or amount.



2.4 Item 1(Video)

(2) The brick walkway at the front of home are deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 2(Video) Water signs at front step



2.4 Item 3(Picture)



2.4 Item 4(Picture)



2.4 Item 5(Picture)

**33977 Stara Lane** Page 8 of 39

(3) Concrete is cracked at front entrance of home. Appears to only affect the slab itself and is more cosmetic.



2.4 Item 6(Picture)

(4) The brick floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.



2.4 Item 7(Picture)

**33977 Stara Lane** Page 9 of 39


(5) The brick floor on the patio at the rear of home is old and deteriorated. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 8(Picture)

**2.5** (1) The wood fascia and soffit panels at eave on the front of home above garage are deteriorated. Repairs are needed to roof covering as well. A qualified contractor should inspect and repair as needed.







2.5 Item 2(Picture)

**33977 Stara Lane** Page 10 of 39

(2) The wood fascia at eave on the right side (facing front) is deteriorated. This is a small repair. A qualified contractor should inspect and repair as needed.



2.5 Item 3(Picture)

**2.8** Possible bees nest forming at right corner of front steps (see video)



2.8 Item 1(Video)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 11 of 39

## 3. Garage

		IN	NI	NP	RR
3.0	Garage Ceiling	•			
3.1	Garage Walls (Including Firewall Separation)	•			
3.2	Garage Floor	•			
3.3	Garage Door (s)	•			
3.4	Occupant Door from Garage to inside home	•			
3.5	Garage Door Operators (Report whether or not doors will reverse when met with resistance)	•			

Garage Door Type:
One automatic
Garage Door Material:

**Styles & Materials** 

Insulated

Metal

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

### **Comments:**

**3.5** The garage door will reverse when met with resistance.

**33977 Stara Lane** Page 12 of 39

## 4. Kitchen Components and Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

4.0	Ceiling	•				
4.1	Walls	•				
4.2	Floor	•				
4.3	Pantry/Closet Doors	•				
4.4	Windows	•				
4.5	Counters and a representative number of Cabinets				•	
4.6	Plumbing Drain and Vent Systems	•				
4.7	Plumbing Water Supply Faucets and Fixtures	•				
4.8	Outlets Wall Switches and Fixtures	•				
4.9	Dishwasher				•	
4.10	Ranges/Ovens/Cooktops	•				
4.11	Range Hood	•				
4.12	Trash Compactor			•		
4.13	Food Waste Disposer	•				
4.14	Microwave Cooking Equipment				•	
4.15	Clothes Dryer Vent Piping	•				
INI — 1m	reported NI- Not Inspected NR- Not Present RR- Repair or Replace	INI	NII	ND	DD	

IN NI NP RR Styles & Materials

**Dishwasher Brand:** KENMORE

**Disposer Brand:** 

IN SINK ERATOR

Exhaust/Range hood: RE-CIRCULATE

Range/Oven:

GENERAL ELECTRIC

**Built in Microwave:** KENMORE

Cabinetry:

Wood

Countertop:

Granite

**Clothes Dryer Vent** 

Material:

**PVC** Rigid

**Dryer Power Source:** 

220 Electric

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

## Comments:

**33977 Stara Lane** Page 13 of 39

4.5 Base Cabinetry and trim at wall cabinet are unfinished at kitchen.





4.5 Item 2(Picture)


4.5 Item 1(Picture)

**4.9** The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.



4.9 Item 1(Video)

**4.14** The microwave door handle is broken. I recommend repair as needed.

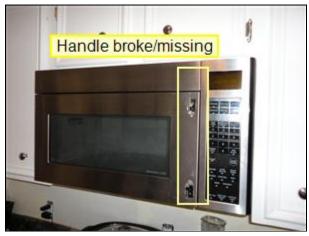

4.14 Item 1(Picture)

**33977 Stara Lane** Page 14 of 39

## **HomeBuyers Inspection HBI**

## Sample

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 15 of 39

### 5. Rooms

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

5.0	Ceilings			•
5.1	Walls			•
5.2	Floors			•
5.3	Steps, Stairways, Balconies and Railings	•		
5.4	Doors (Representative number)	•		
5.5	Windows (Representative number)	•		
5.6	Outlets, Switches and Fixtures	•		

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

#### IN NI NP RR Styles & Materials

Ceiling Materials:
Drywall
Suspended ceiling
panels

Wall Material:

Drywall

Floor Covering(s):

Carpet Hardwood T&G

**Interior Doors:** 

Raised panel Wood

Window Types:

Casement Double-hung Thermal/Insulated Tilt feature

Window

Manufacturer: UNKNOWN

### **Comments:**

**5.0** (1) The Sheetrock on the ceiling reveals a water stain indicating a leak did or still exists at the Den. Repairs are needed. A qualified contractor should inspect and repair as needed (See Roof Coverings).



5.0 Item 1(Picture)

**33977 Stara Lane** Page 16 of 39

(2) Water stain on ceiling panel lower level indicates plumbing leak.




5.0 Item 2(Picture)

(3) The Drywall on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.





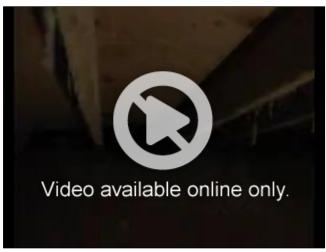

5.0 Item 4(Video)

**33977 Stara Lane** Page 17 of 39

- 5.1 (1) Unfinished around windows in kitchen, and Den.
- (2) The Wall at the bathtub is deteriorated and needs repair or replacement. The wall board and framing may need repair (not visible). I recommend repair or replace using a qualified contractor.



5.1 Item 1(Picture)

(3) The sheetrock on the wall is dented or damaged from door knob at the hallway. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.



5.1 Item 2(Picture)

**33977 Stara Lane** Page 18 of 39

(4) Stair cover trim is unfinished needs prep and paint at stairs.



5.1 Item 3(Picture)

◆ 5.2 Carpet is loose or cut short from where electric baseboard use to be in areas around the perimeter of the Den.



5.2 Item 1(Picture)

**5.3** Stair side trim have been prepped some but unfinished.

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 19 of 39

## **6. Bathroom and Components**

### IN NI NP RR Styles & Materials

6.0	Counters and Cabinets	•		
6.1	Doors (Representative number)	•		
6.2	Windows	•		
6.3	Plumbing Drain, Waste and Vent Systems	•		
6.4	Plumbing Water Supply and Distribution Systems and Fixtures	•		
6.5	Outlets Switches and Fixtures	•		
6.6	Exhaust fan	•		

Exhaust Fans: Fan/Heat/Light

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

**33977 Stara Lane** Page 20 of 39

## 7. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

		IN	NI	NP	RR
7.0	Foundations, Basements and Crawlspaces (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	•			
7.1	Walls (Structural)	•			
7.2	Columns or Piers	•			
7.3	Floors (Structural)	•			
7.4	Ceilings (Structural)	•			
7.5	Insulation under Floor System	•			
7.6	Vapor Retarders (On ground in crawlspace or basement)	•			
7.7	Ventilation of Foundation Area (crawlspace or basement)	•			

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Masonry block

Foundation: Masonry block

Method used to

**observe Crawlspace:** 

**Styles & Materials** 

Limited access

Floor Structure:

2 X 8 Wood joists

Slab Engineered floor trusses

**Wall Structure:** 

Masonry 2 X 4 Wood

**Columns or Piers:** 

Steel lally columns Supporting walls

Floor System

Insulation:

IN NI NP RR

Unfaced Batts Fiberglass R-19

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 21 of 39

## 8. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

8.0	Plumbing Drain, Waste and Vent Systems	•		
8.1	Plumbing Water Supply and Distribution Systems and Fixtures	•		
8.2	Hot Water Systems, Controls, Chimneys, Flues and Vents	•		
8.3	Main Water Shut-off Device (Describe location)	•		
8.4	Fuels Storage and Distribution Systems (Interior fuel storage, piping, venting, supports, leaks)		•	
8.5	Main Fuel Shut-off (Describe Location)		•	
8.6	Sump Pump	•		

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

### IN NI NP RR Styles & Materials

Water Source: Public

Water Filters:

None

**Plumbing Water** 

Supply (into home):

Copper

**Plumbing Water** 

**Distribution (inside** 

home):

Copper

Washer Drain Size:

2" Diameter

**Plumbing Waste Line:** 

PVC

**Water Heater Power** 

Source:

Electric

**Water Heater** 

Capacity:

50 Gallon (2-3 people)

**Water Heater** 

Manufacturer:

A.O. SMITH

Water Heater

Location:

**Under Stairs** 

#### **Comments:**

**8.3** The main shut off is the blue knob located at the lower level right when exiting to outside behind small door on wall. This is for your information.

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 22 of 39

## 9. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Builtin vacuum equipment.

		IN	NI	NP	RR	Styles & Materials
9.0	Service Entrance Conductors	•				Electrical Service
9.1	Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels	•				Conductors: Overhead service 220 volts
9.2	Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage	•				Panel capacity: 200 AMP
9.3	Connected Devices and Fixtures (A representative number of ceiling fans, lighting fixtures, switches, and receptacles inside the house, garage, and on the exterior walls)	•				Panel Type: Circuit breakers Electric Panel
9.4	Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage and exterior walls of inspected structure	•				Manufacturer: GENERAL ELECTRIC Branch wire 15 and 20
9.5	Operation of GFCI (Ground Fault Circuit Interrupters)	•				AMP: Copper
9.6	Location of Main and Distribution Panels	•				Wiring Methods: Romex
9.7	Smoke Detectors	•				romex
9.8	Carbon Monoxide Detectors	•				
IN=	Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace	IN	NI	NP	RR	

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 23 of 39

## 10. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

10.0	Heating Equipment	•		
10.1	Normal Operating Controls	•		
10.2	Automatic Safety Controls	•		
10.3	Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)			•
10.4	Presence of installed Heat Source in each room	•		
10.5	Chimneys, Flues and Vents (for fireplaces, gas water heaters, or heat systems)	•		
10.6	Solid fuel heating devices (Fireplaces, Woodstove)	•		
10.7	Gas/LP Firelogs and Fireplaces	•		
10.8	Cooling and Air Handler Equipment	•		
10.9	Normal Operating Equipment	•		
10.10	Presence of installed Cooling Source in each room	•		

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

## IN NI NP RR Styles & Materials Heat Type:

Heat Pump Forced Air (also provides cool air)

**Energy Source:** 

Electric

**Number of Heat** 

**Systems (excluding** 

wood):

Two

**Heat System Brand:** 

**BRYANT** 

**Ductwork:** 

Insulated

Filter Type:

Washable

Types of Fireplaces:

Conventional

**Operable Fireplaces:** 

One

Number of

**Woodstoves:** 

None

**Cooling Equipment** 

Type:

Heat Pump Forced Air (also provides warm air)

Cooling Equipment

**Energy Source:** 

Electricity

**Central Air** 

Manufacturer:


BRYANT

**Comments:** 

**33977 Stara Lane** Page 24 of 39

**10.3** The washable filter is dirty. The filter needs to be cleaned. Recommend foil taping the filter for a better seal. See Video. Foam sleeve missing at suction line creates condensation and drips water.







10.3 Item 2(Picture)



10.3 Item 3(Video)

**10.8** Air handler and heat pump is old but appears to be working properly. Foam sleeve on suction line is not covering copper line and condensation can drip.



10.8 Item 1(Video)



10.8 Item 2(Picture)

**33977 Stara Lane** Page 25 of 39

## **HomeBuyers Inspection HBI**

## Sample

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**33977 Stara Lane** Page 26 of 39

## 11. Home Warranty Offer

11.0 This home is eligible for a one year Home Warranty offer!

### **Comments:**

11.0 Items included in the one year home warranty if purchased are: Furnaces, Boilers, Heat Pumps, Central Air Conditioners, Electrical System, Thermostats, Water heater System, Plumbing, Polybutylene lines, Sump Pump, WhirlPools, Dishwasher, Food Waste Disposer, Cooking Range/Oven, Microwave, Kitchen Refrigerator, Trash Compactor, Plumbing Fixtures and Faucets, Domestic Water Softener, Clearing of Line Stoppage, Well Water System, Refrigerant Recapture and Disposal, Permits in conjunction with a covered repair, Code Violations in conjunction with a covered repair, Improper installation or modification, Removal of defective equipment, Fireplace gas burner, Attic and Exhaust fans, Humidifiers, Dehumidifiers, Electronic Air Filtering Devices, Door bell System, Lighting Fixtures, Septic Lines, Ejector pump. For more information and to compare warranties or purchase this warranty, please click on the Warranty offer beside your uploaded report.

**33977 Stara Lane** Page 27 of 39

## **General Summary**

## **HomeBuyers Inspection HBI**

122 Lyman Street Building 1 Asheville, NC 28801 828-254-2030

## Customer

Danica Sample

### **Address**

33977 Stara Lane Hendersonville NC

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling;** or **warrants further investigation by a specialist,** or **requires subsequent observation.** This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

## 1. Roofing / Chimneys / Roof Structure and Attic

### 1.0 Roof Coverings

### **Repair or Replace**

- (1) Evidence of a leak in the Den below corresponds with the middle skylight roof and flashing area. Repairs are needed. Recommend a qualified contractor inspect further and repair as needed.
- (2) The roof covering was installed improperly above garage. Roof sheathing needs to be replaced in this area. This will involve some shingle replacement. A qualified contractor should inspect and repair as needed.



1.0 Item 1(Picture)

**33977 Stara Lane** Page 28 of 39

### 1.4 Roof Drainage Systems (gutters and downspouts)

### **Repair or Replace**

The gutter screens are missing at the front of home above garage. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.

## 2. Exterior

### 2.0 Wall Cladding, Flashing and Trim

### **Repair or Replace**

The Wood siding at the right side (facing front) and rear of home is missing or incomplete at time of inspection around new premium windows that have recently been installed. I did not inspect the installation of siding at this location. A qualified contractor should inspect and repair as needed. The siding will need prep and paint.






2.0 Item 1(Picture)

2.0 Item 2(Picture)







2.0 Item 4(Picture)

**33977 Stara Lane** Page 29 of 39

2.4 Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)

### **Repair or Replace**

(1) Possible water run-off from the street into driveway during rain. I am unable to determine the frequency or amount.



2.4 Item 1(Video)

(2) The brick walkway at the front of home are deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 2(Video) Water signs at front step



2.4 Item 3(Picture)

**33977 Stara Lane** Page 30 of 39





2.4 Item 4(Picture)

2.4 Item 5(Picture)

(4) The brick floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.



2.4 Item 7(Picture)

(5) The brick floor on the patio at the rear of home is old and deteriorated. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 8(Picture)

**33977 Stara Lane** Page 31 of 39

### 2.5 Eaves, Soffits and Fascias

### **Repair or Replace**

(1) The wood fascia and soffit panels at eave on the front of home above garage are deteriorated. Repairs are needed to roof covering as well. A qualified contractor should inspect and repair as needed.





2.5 Item 1(Picture)

2.5 Item 2(Picture)

(2) The wood fascia at eave on the right side (facing front) is deteriorated. This is a small repair. A qualified contractor should inspect and repair as needed.



2.5 Item 3(Picture)

## 4. Kitchen Components and Appliances

## 4.5 Counters and a representative number of Cabinets

### **Repair or Replace**

A Base Cabinetry and trim at wall cabinet are unfinished at kitchen.

**33977 Stara Lane** Page 32 of 39





4.5 Item 2(Picture)

4.5 Item 1(Picture)

### 4.9 Dishwasher

### **Repair or Replace**

The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.




4.9 Item 1(Video)

### 4.14 Microwave Cooking Equipment

### **Repair or Replace**

The microwave door handle is broken. I recommend repair as needed.

**33977 Stara Lane** Page 33 of 39

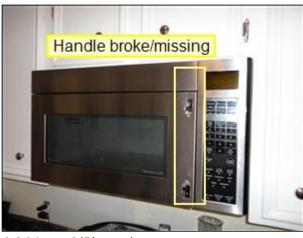

4.14 Item 1(Picture)

### 5. Rooms

### 5.0 Ceilings

### **Repair or Replace**

(1) The Sheetrock on the ceiling reveals a water stain indicating a leak did or still exists at the Den. Repairs are needed. A qualified contractor should inspect and repair as needed (See Roof Coverings).



5.0 Item 1(Picture)

(2) Water stain on ceiling panel lower level indicates plumbing leak.


**33977 Stara Lane** Page 34 of 39



5.0 Item 2(Picture)

(3) The Drywall on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.



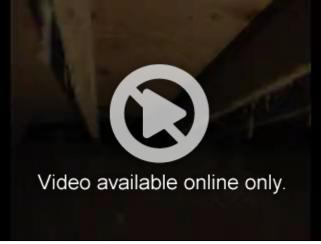

5.0 Item 3(Picture)

5.0 Item 4(Video)

### 5.1 Walls

### **Repair or Replace**

- (1) Unfinished around windows in kitchen, and Den.
- (2) The Wall at the bathtub is deteriorated and needs repair or replacement. The wall board and framing may need repair (not visible). I recommend repair or replace using a qualified contractor.

**33977 Stara Lane** Page 35 of 39



5.1 Item 1(Picture)

(3) The sheetrock on the wall is dented or damaged from door knob at the hallway. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.



5.1 Item 2(Picture)

(4) Stair cover trim is unfinished needs prep and paint at stairs.




5.1 Item 3(Picture)

### 5.2 Floors

**33977 Stara Lane** Page 36 of 39

### **Repair or Replace**

Carpet is loose or cut short from where electric baseboard use to be in areas around the perimeter of the Den.

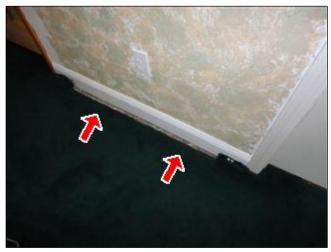

5.2 Item 1(Picture)


## 10. Heating / Central Air Conditioning

10.3 Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

### **Repair or Replace**

The washable filter is dirty. The filter needs to be cleaned. Recommend foil taping the filter for a better seal. See Video. Foam sleeve missing at suction line creates condensation and drips water.







10.3 Item 2(Picture)

**33977 Stara Lane** Page 37 of 39



10.3 Item 3(Video)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <a href="http://www.HomeGauge.com">http://www.HomeGauge.com</a> : Licensed To Cleveland Bailey II

**33977 Stara Lane** Page 38 of 39

## **INVOICE**

HomeBuyers Inspection HBI 122 Lyman Street Building 1 Asheville, NC 28801 828-254-2030

**Inspected By: Russell Buchanan** 

**Inspection Date:** 3/30/2012 **Report ID:** 33977staralane

Customer Info:	Inspection Property:
Danica Sample	33977 Stara Lane Hendersonville NC
Customer's Real Estate Professional: Victor Tate Victor Realty	

## **Inspection Fee:**

Service	Price	Amount	Sub-Total
Heated Sq Ft 3,001 - 3,500	400.00	1	400.00
Radon test with kit	125.00	1	125.00

**Tax \$**0.00

**Total Price \$**525.00

Payment Method: Cash Payment Status: Paid

Note:

**33977 Stara Lane** Page 39 of 39